



ECE421: Electronics for Instrumentation
MEP382: Design of Applied Measurement Systems
Lecture #2: Transduction Mechanisms

Mostafa Soliman, Ph.D.

April 28th 2014

Slides are borrowed from Dr. Moahmed Elshiekh lectures

Outline

- Capacitive Transducers
- Inductive Transducers
- Hall Effect Transducers
- Resistive Transducers
- Piezoresistive Transducers
- Piezoelectric Transducers




Capacitive Transducers

- ❑ What is a capacitance ?
- ❑ How to have a capacitive transducer ?
- ❑ Capacitor transduction configurations
- ❑ Capacitor transducer applications
- ❑ How to interface a capacitor transducer ?




What is a capacitance ?

- It is the property of a conductor that permits it to store charges on its surface.
- It is the proportionality constant between the **charge developed** on a conductor surface and the **potential difference** needed to get these charges .

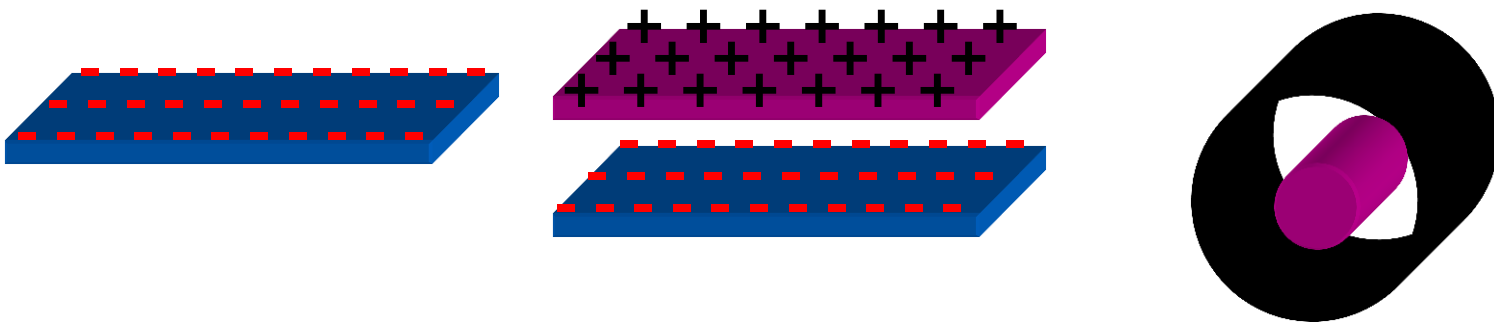

What is a capacitive transducer ?

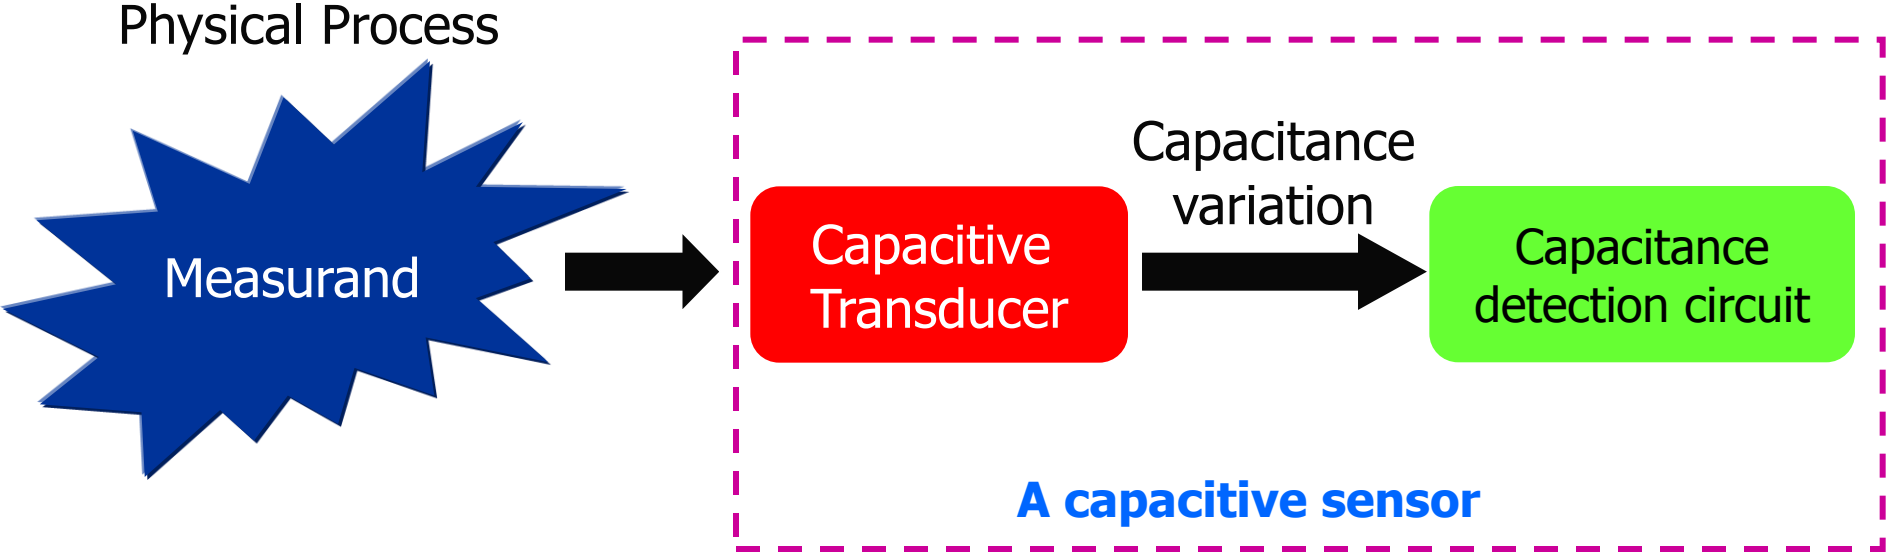


Capacitor Transduction Configurations

$$C = f(\epsilon_r, A, g)$$

□ Where:

- ϵ_r is the relative permittivity of the dielectric enclosed.
- A is the conductor electrode area
- g is the gap between the conductor electrodes

$$C = \frac{\epsilon_0 \epsilon_r A}{g}$$

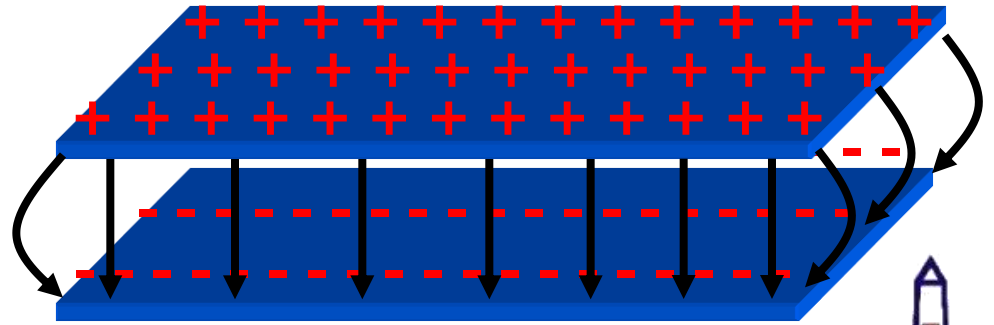

Variable Gap Capacitive Transducer

- The gap is changing by the physical parameters.
- **Example:** Displacement or Pressure measurement

$$\frac{dC(x)}{dx} = \frac{C_o / g_o}{(1 - x / g_o)^2}$$

Transducer Sensitivity

$$C(x) = \frac{\epsilon_o \epsilon_r A}{g_o - x} = \frac{C_o}{1 - x / g_o}$$




Variable Area Capacitive Transducer

- The overlap area is changing by the physical parameters.
- **Example:** Displacement or Pressure measurement

$$\frac{dC(x)}{dx} = C_o / w_o$$


Transducer Sensitivity

$$C(x) = \frac{\epsilon_o \epsilon_r t (w_o - x)}{g_o} = C_o (1 - x / w_o)$$

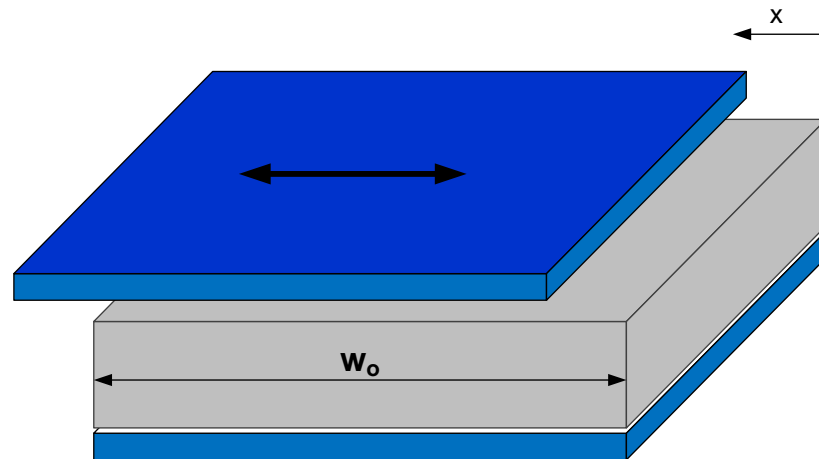


Differential Capacitive Transducer


□ The idea is to use a middle electrode to produce a differential capacitor variation through a three terminal device

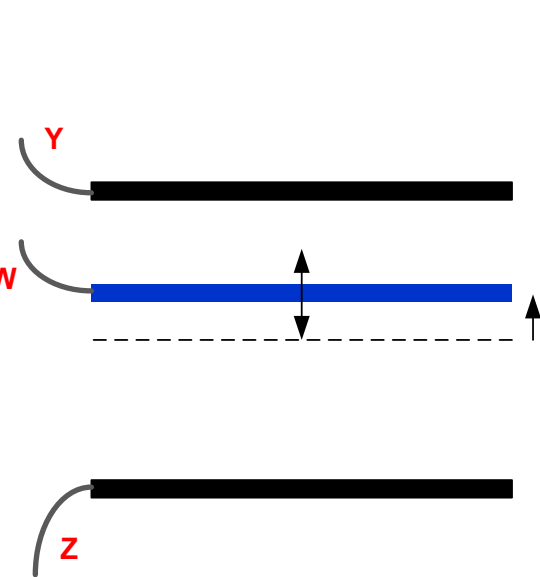

Variable gap

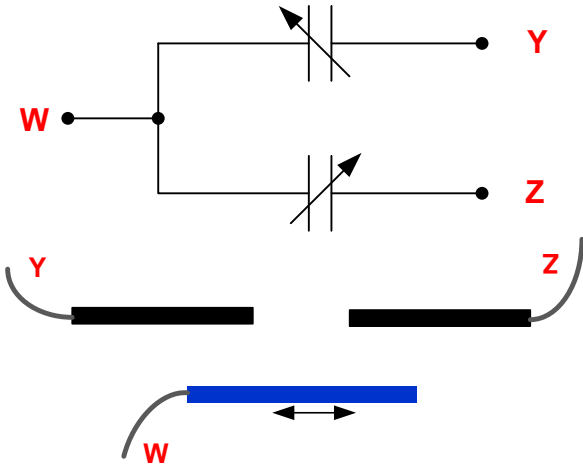


Variable area

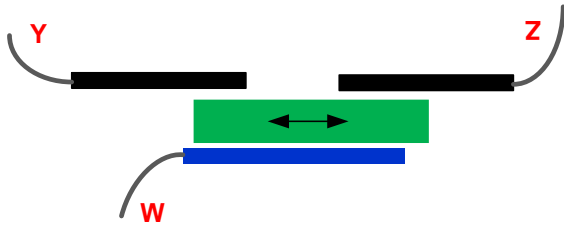

Variable dielectric





Practicable differential implementation

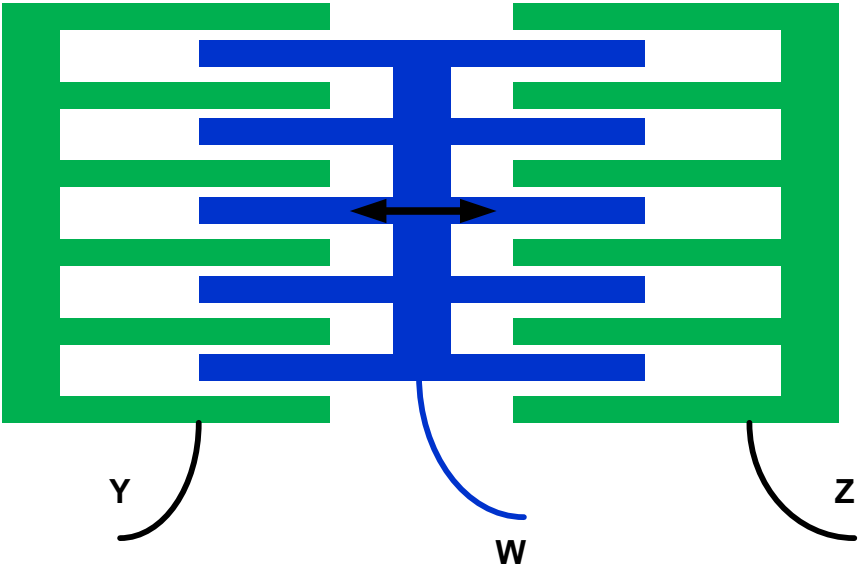


Overlap Comb-finger Capacitor


Gap closing Comb-finger Capacitor

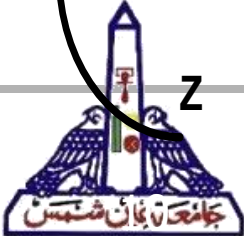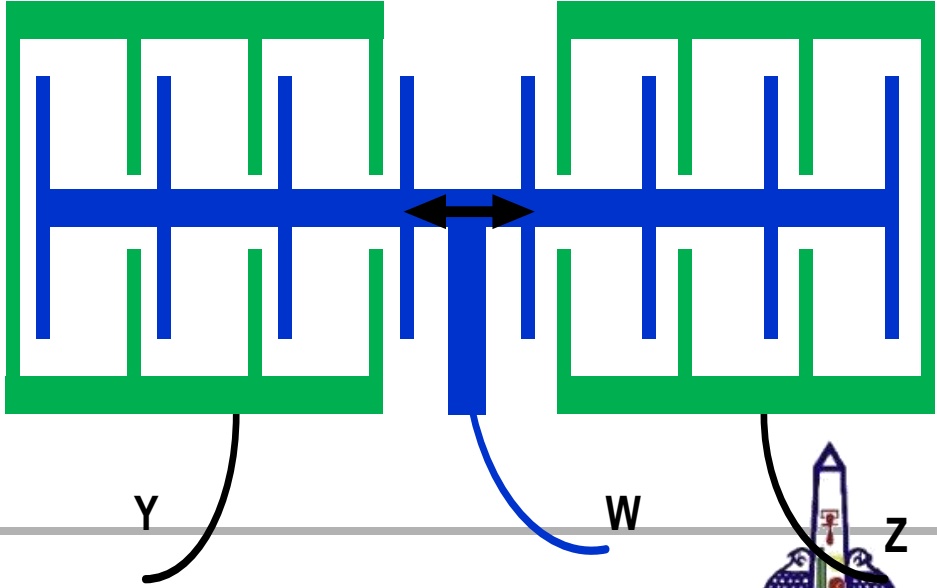


Capacitive Transducer circuits (C2V)

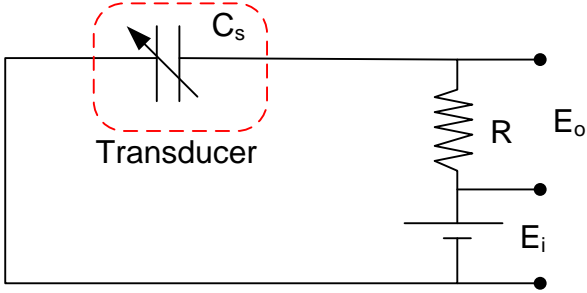


$$\frac{E_o}{E_i} = \frac{sC_s R}{1 + sC_s R}$$

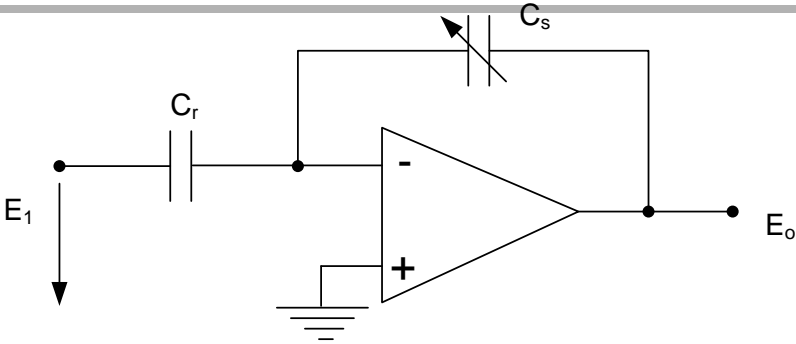

$$\frac{E_o}{E_i} = -\frac{C_r}{C_s}$$

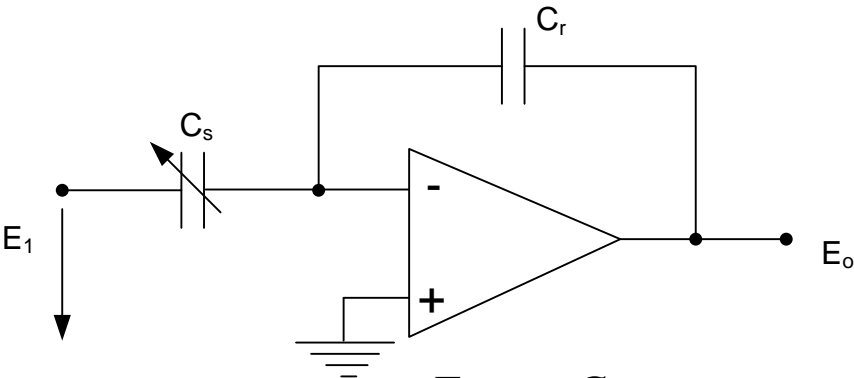

$$\frac{E_o}{E_i} = -\frac{C_s}{C_r}$$

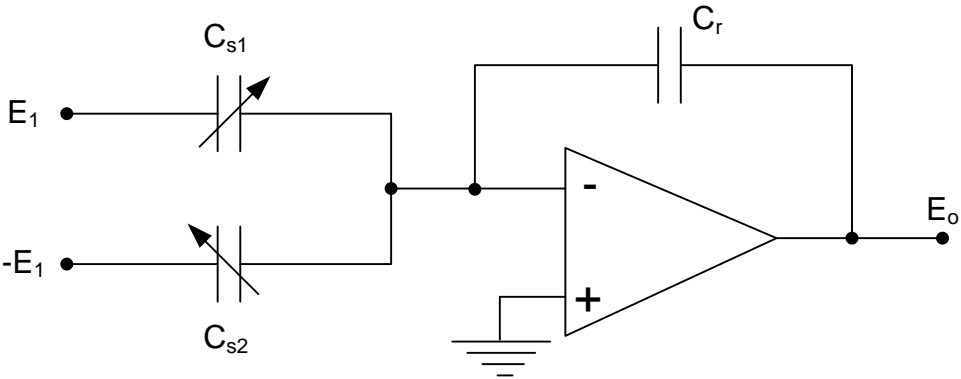

$$\frac{E_o}{E_i} = ??$$



Outline

- Capacitive Transducers
- Inductive Transducers
- Hall Effect Transducers
- Resistive Transducers
- Piezoresistive Transducers
- Piezoelectric Transducers



Inductive Transducers

- An **inductive transducer** is designed such that the measurand alters the (self) inductance of the sensor's coil to produce either a change in current through the coil or a change in the voltage across the coil.
- The **(self) inductance** L is an indication of the ability of a coil to oppose any change in current flowing through the coil. The inductance L of a cylindrical coil is given by:

$$L = \mu \frac{n^2 A}{l}$$



where

- L is the inductance [Henry, H]
- μ is the permeability of the core [Wb/A-t-m]
- n is the number of turns of coil
- A is the cross sectional area of core [m^2]
- l is the length of core [m]





How to make an Inductive Transducer ?

- One of the most common ways of producing such a change is to use a movable core which moves back and forth inside a coil, where the permeability is varied as the core is displaced within the coil.
- The core is usually made of a highly permeable material such as ferrite and iron.

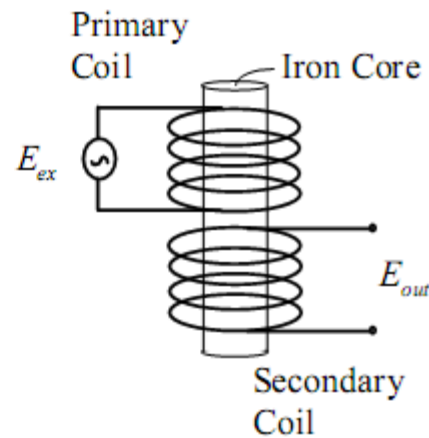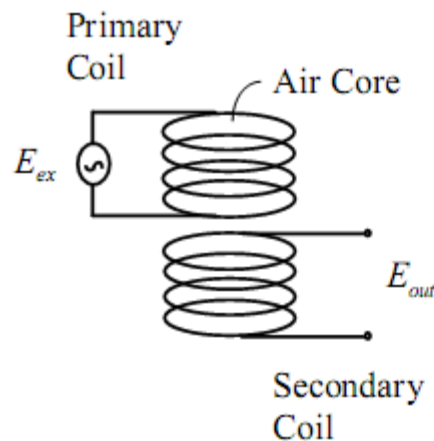

LVDT Transducer

- Linear Variable Differential Transformer (LVDT) transducer has two sets of coils, a primary coil and two secondary coils.
- The secondary coils are wound in opposite directions such that if the core moves to either direction, the voltage in one of the secondary coils increases while it decreases in the other, generating a nonzero voltage output. When the core is located at the center, the output is zero.

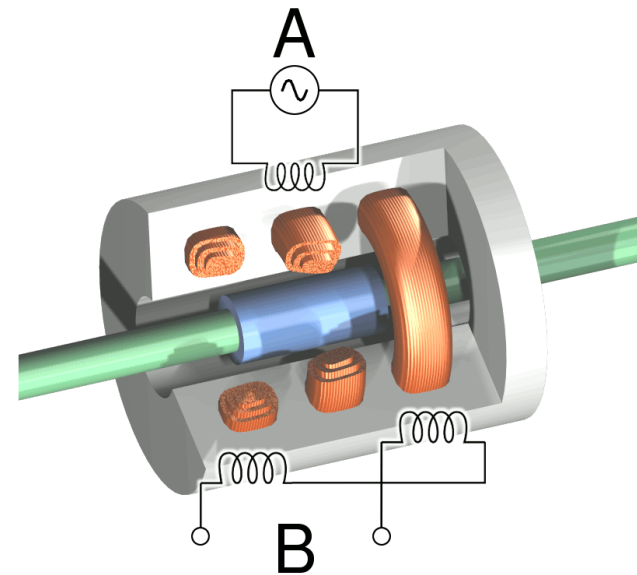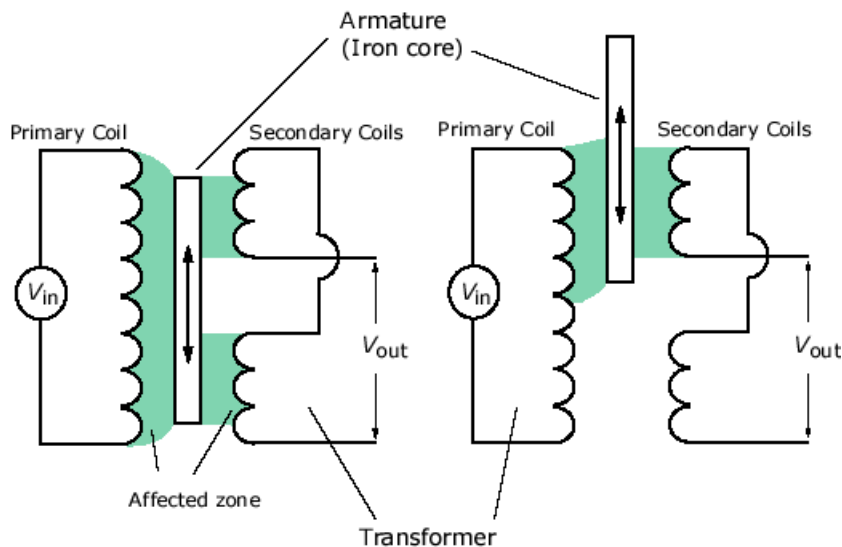

Outline

- Capacitive Transducers
- Inductive Transducers
- Hall Effect Transducers
- Resistive Transducers
- Piezoresistive Transducers
- Piezoelectric Transducers




Hall Effect Transducers

- ❑ This physical effect was discovered in 1879 by Edwin Hall.
- ❑ Hall sensors are used to detect **magnetic field**, **position** and **displacement** of objects without physical contact, contactless.


Using: $V_H = h i B \sin \alpha$

where:



- h is the Hall coefficient
- B is the magnetic flux density
- α is the angle between the magnetic field and the Hall plate

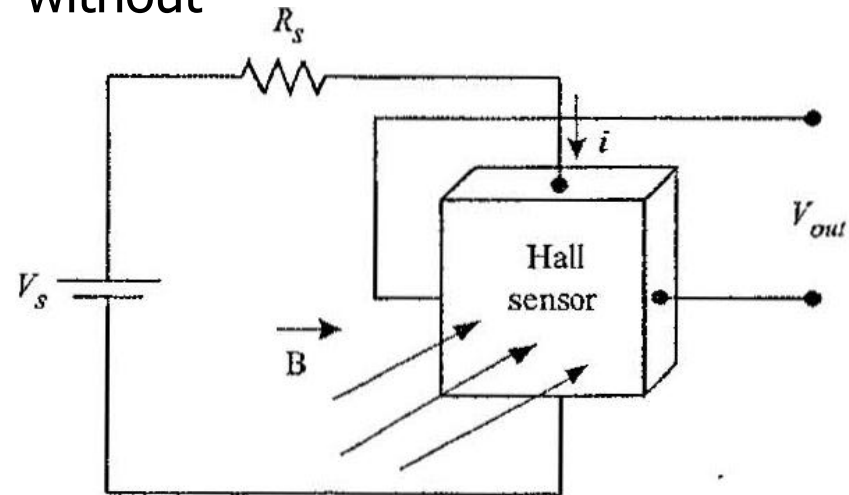

Typical Hall Effect Transducer

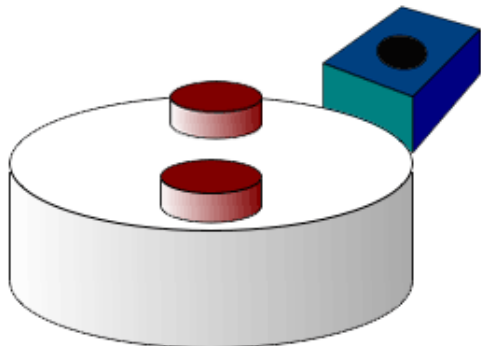

Rotation Detection

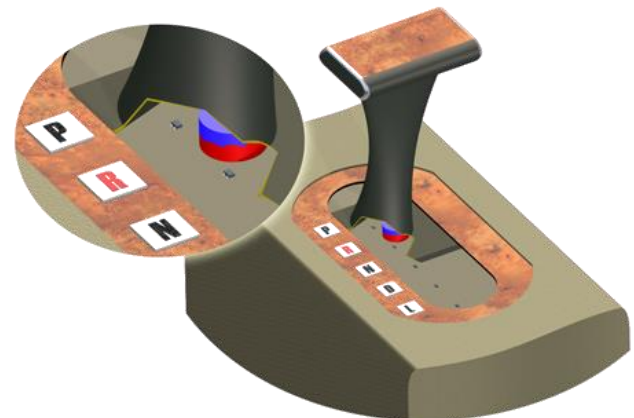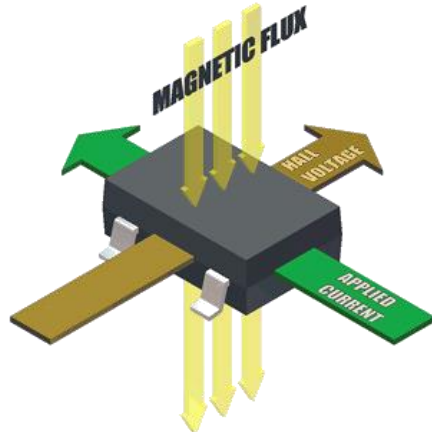

Gear Shift



Outline

- Capacitive Transducers
- Inductive Transducers
- Hall Effect Transducers
- Resistive Transducers
- Piezoresistive Transducers
- Piezoelectric Transducers



Resistive Transducers

- Resistance is a characteristic of a device. It depends on both the material and the geometry of the resistor.
- For a conductor:

$$R = \frac{\rho \cdot L}{A}$$

- Where:
 - $\rho = 1/\sigma$ is the resistivity of the material
 - L is the length of the conductor
 - A is the cross-sectional area of the conductor



Temperature Measurement

- ❑ Resistivity, material property, has temperature dependence
- ❑ The temperature dependence determines the type of the sensor, RTDs or Thermistors.
- ❑ Resistive temperature Detectors (RTD):
 - They are made of metals and are characterized by positive temperature dependence.
 - Platinum is the best material because of its small resistivity and strong temperature dependence.

$$\rho = \rho_0 (1 + \sigma_1 (t - t_0) + \sigma_2 (t - t_0)^2)$$



Temperature Measurement (2)

□ Thermistors:

- Thermistors are resistors with large either negative (NTC) or positive (PTC) temperature coefficients.
- They are usually ceramic semiconductors commonly made of oxides of one or more of the following metals: nickel, manganese, cobalt, titanium, iron.
- Their resistances vary from a fraction of an ohm to many mega ohms.

$$R_t = R_{t0} e^{\beta(1/T-1/T0)}$$



Outline


- Capacitive Transducers
- Inductive Transducers
- Hall Effect Transducers
- Resistive Transducers
- Piezoresistive Transducers
- Piezoelectric Transducers



Piezoresistive Transducers: Stress Measurement

- Stress measurement by using the piezoresistive phenomena.

$$R = \frac{\rho \cdot l^2}{v}$$
$$\frac{dR}{dl} = \frac{2\rho \cdot l}{v}$$
$$\frac{dR}{R} = 2 \frac{dl}{l} = S_e \varepsilon$$

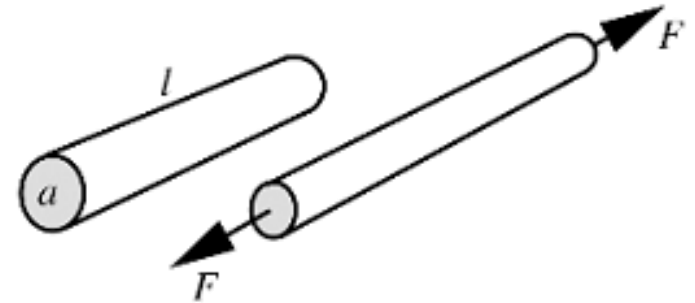

$$\sigma = E \frac{dl}{l} = E \varepsilon$$

- S_e ranges between 2-6 in metals/alloys and 40-200 in semiconductors.
- Si and Ge has good piezoelectric properties


Detection Mechanism

- A bridge is typically used to transfer ΔR into ΔV .
- Wheatstone bridge @ Null condition:

$$R_x = \frac{R_2}{R_1} R_3$$

- Without Null condition:

$$V_G = \left(\frac{R_x}{R_x + R_3} - \frac{R_2}{R_1 + R_2} \right) V_s$$

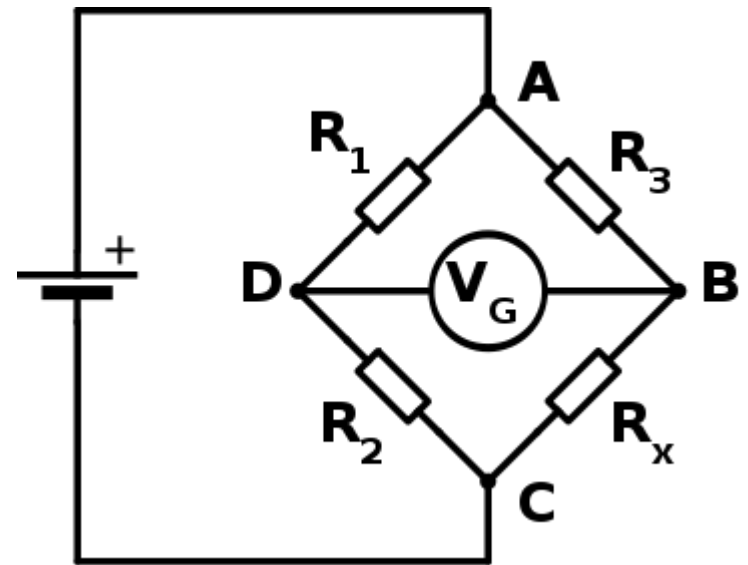


Outline

- Capacitive Transducers
- Inductive Transducers
- Hall Effect Transducers
- Resistive Transducers
- Piezoresistive Transducers
- Piezoelectric Transducers



Piezoelectric Transducers

- The piezoelectric effect is the generation of electric charge by a crystalline material upon subjecting it to stress.
- The effect exists in natural crystals, such as quartz (chemical formula SiO_2), and poled (artificially polarized) man-made ceramics and some polymers, such as polyvinylidene flouride.
- The Curie brothers discovered the piezoelectric effect in quartz in 1880.

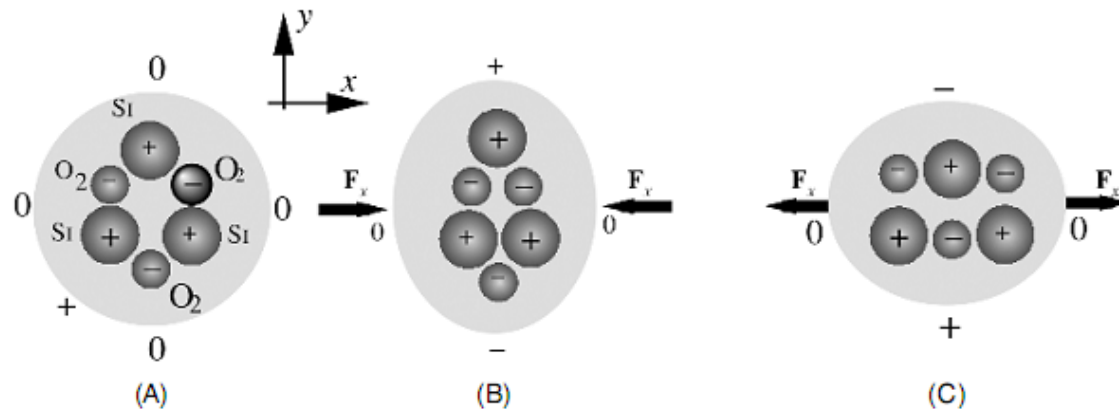

Piezoelectric Transducers (2)

- ❑ The piezoelectric effect is a **reversible** physical phenomenon. That means that applying voltage across the crystal produces mechanical strain.
- ❑ To pick up an electric charge or apply a voltage , **conductive electrodes** must be applied to the crystal at the opposite sides of the cut.
- ❑ A piezoelectric sensor becomes a **capacitor** with a dielectric material which is a piezoelectric crystal.

